		NTSB ID: ANC98MA008		Aircraft Registration Number: N750GC	
		Occurrence Date: 11/08/1997		Most Critical Injury: Fatal	
		Occurrence Type: Accident		Investigated By: NTSB	
Location/Time					
Nearest City/Place BARROW	State AK	Zip Code 99723	Local Time 0808	Time Zone AST	
Airport Proximity: Off Airport/Airstrip		Distance From Landing Facility: 1		Direction From Airport: 270	
Aircraft Information Summary					
Aircraft Manufacturer Cessna		Model/Series 208B		Type of Aircraft Airplane	
Sightseeing Flight: No			Air Medical Transport Flight: No		
Narrative					
<p>Brief narrative statement of facts, conditions and circumstances pertinent to the accident/incident:</p> <p>HISTORY OF FLIGHT</p> <p>On November 8, 1997, at 0808 Alaska standard time, a Cessna 208B airplane, N750GC, was destroyed when it impacted water in the Arctic Ocean, about one-half mile west of Barrow, Alaska. The airline transport certificated pilot, and the seven passengers on board, sustained fatal injuries. The airplane was operated by Hageland Aviation Services, Inc., of St. Mary's, Alaska, under 14 CFR Part 135, as scheduled commuter Flight 500. The destination was Wainwright, Alaska. Night, visual meteorological conditions (VMC) prevailed at the time of the accident, and a VFR flight plan was filed.</p> <p>At 0802, the pilot radioed to the FAA Flight Service Station (FSS) that he was taxiing for takeoff, and filed a flight plan to Wainwright with eight persons on board, two hours en route, and three hours of fuel. At 0804, the pilot reported that he was back taxiing for runway 24. At 0806, he transmitted that he was departing runway 24. At 0808, two annunciations of an Emergency Locator Transmitter(ELT) were heard on 121.5 MHz by the FSS specialist on duty.</p> <p>The pilot of a Cessna 207 which had earlier departed runway 06 for Wainwright reported hearing the pilot say, "mayday, mayday" and that he saw the airplane's lights descend "straight down into the water." The witness pilot had been talking previously to the accident pilot on 127.77 MHz, and overheard the "mayday" call on that frequency. The witness pilot revealed that he was at 700 feet MSL, and that the accident airplane never reached his altitude.</p> <p>The airplane came to rest submerged in twenty-one feet of water, approximately 200 yards offshore. The fuselage and left wing were recovered the evening of the accident, with the right wing, engine, and various other components recovered separately over the next two day period.</p> <p>One passenger occupied the right-front crew seat, five passengers occupied the installed passenger seats, and a single infant was being held by her mother as a lap child. All occupants were recovered from the interior of the airplane, still restrained in their seats, except for the infant, who was located in the aft cabin.</p> <p>The accident flight was the company's first flight of the day. The lineman who assisted the pilot prepare the airplane for departure, told the NTSB investigator-in-charge (IIC) that after he fueled the airplane's left wing, there were no "ribbons or strings" hanging down from the airplane, and there were no covers on the pitot tubes. The lineman, and the company dispatcher who was helping prepare the flight, described the pilot as "the same as he always was," and in a hurry to make the scheduled takeoff time.</p> <p>DAMAGE TO AIRCRAFT</p>					
FACTUAL REPORT - AVIATION					

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

The airplane was destroyed by a combination of impact forces and recovery damage. The airplane was described by the divers who first arrived on scene to be resting upright on the ocean floor in 21 feet of water. The wings were attached to the fuselage, but the engine was not. These divers described the leading edges of both wings as damaged. During recovery of the airplane, ropes were attached to the wing struts and landing gear, for towing by boats. While being towed, the airplane rolled over, and the right wing separated. The left wing remained attached by cables.

PERSONNEL INFORMATION

The pilot held an airline transport pilot certificate for multiengine airplanes, and a commercial pilot certificate for single-engine airplanes. His first class medical certificate contained no restrictions. He also possessed an airframe and powerplant mechanic license. The pilot was first hired by the company as the station manager at McGrath, Alaska, on June 23, 1994. He had been employed by the operator as the station manager in Barrow since June of 1997, and had flown 220 hours in the Barrow area. According to the company president, the pilot's primary duty was to manage the station, and he was not required to fly as a pilot. The pilot's wife said he enjoyed flying, and normally would take the first flight in the morning, which then allowed him to concentrate on his management duties for the remainder of the day.

The pilot was qualified in Cessna 185, 206, 207, and 208 airplanes. At the time of the accident, he had accumulated about 3,500 hours of flight time. Between June 23 and 27, 1997, he attended initial training in the Cessna 208B at Flight Safety International, Inc., Wichita, Kansas. The pilot had accrued 161 hours of experience in the Cessna 208B, and had flown 20.1 hours in the week prior to the accident, all in the Cessna 208B.

The pilot's most recent 14 CFR Part 135 proficiency check was conducted on June 27, 1997, as part of his initial qualification in the Cessna 208B.

AIRCRAFT INFORMATION**General**

The airplane was a Cessna 208B "Grand Caravan," manufactured in January 1996, by the Cessna Aircraft Company, Inc., of Wichita, Kansas. The airplane was operated as a company demonstration aircraft by Cessna Aircraft Company, Inc., until it was sold on May 16, 1997, to Gussic Ventures, Inc., of Anchorage, Alaska, who leased it to Hageland Aviation Services, Inc. The airplane was powered by a single Pratt & Whitney PT6A-114A turboprop engine, rated to produce 675 shaft horsepower. The airplane had accumulated 1,438 total hours in operation at the time of the accident.

The airplane was equipped with the capability of seating up to nine passengers. At the time of the accident, five passenger seats were installed. The remaining seats were stowed in the aft cargo compartment, to make room for a casket being carried as cargo in the cabin. The airplane also carried a cargo pod installed underneath the belly of the airplane.

The airplane was equipped for flight into instrument meteorological conditions (IMC), although at the time of the accident, the company's FAA approved Operating Specifications did not authorize passenger carrying operations in single-engine airplanes during IMC.

The airplane was maintained on a Cessna periodic maintenance schedule, under an Approved Aircraft Inspection Program (AAIP). This was approved on the company's Operations Specifications in paragraph D73. This AAIP was developed from the Cessna Aircraft Company Recommended Maintenance Program for the Cessna 208B airplane. It was comprised of 12 "Phase" inspections, one accomplished each 200 hours, with "mini" checks each intermediate 100 hours. When utilizing this AAIP, the entire aircraft is inspected with the completion of any four consecutive phase inspections. All

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

inspections were current at the time of the accident. The most recent maintenance performed was a "Phase 4" inspection completed on November 1, 1997, 28 hours prior to the accident.

A review of maintenance records revealed no repetitive maintenance problems, except for a captain's Heading Situation Indicator (HSI) replacement on June 19, October 27, October 28, and October 29, 1997. No further discrepancies with the captain's HSI were noted. The accident airplane was flown on three flights by a different pilot on November 7, the day prior to the accident. This pilot did not recall any discrepancies with the airplane.

Weight and Balance

When questioned on how much fuel remained in the airplane when he returned from the final flight on the evening of November 7, the previous pilot told the Safety Board that he believed the airplane had approximately 600 to 700 total pounds of fuel, with 350 pounds in each wing. He did not fuel the airplane upon his return from the flight which preceded the accident.

The morning of the accident flight, the pilot directed that the left wing be "topped off" by a new employee. This was the employee's second day on the job, and he had no previous experience working on, or around, airplanes. When interviewed by the NTSB operations group chairman, he described unrolling the fueling hose from its storage location, and fueling the left wing until fuel "sloshed" out of the overwing fueling receptacle. He assumed this meant the tank was full, and then stopped. He said he placed no fuel in the right wing.

In order to determine how much fuel the lineman may have actually placed in the left wing tank, the investigation team asked the employee to fill a Cessna 208B left wing in the same manner as he fueled the accident airplane. The fuel level in the test wing was then read from the fuel gauges in the cockpit to be 800 pounds. Each wing has a total capacity of 1,122 pounds of Jet-A fuel (167.5 gallons).

Cargo on board the airplane consisted of an estimated 280 pounds of passenger's personal baggage, 98 pounds of freight, 354 pounds of bypass mail located in the belly mounted cargo pod, and a 418 pound casket containing a deceased relative of the passengers. The casket was secured in the cabin by one-inch wide, tubular nylon webbing cargo straps, and located aft of the passenger seats. The dispatcher said that as she placed the passenger's luggage on the scales, the pilot removed them for loading before she could record the weights.

The airplane's published maximum allowable takeoff weight was 8,750 pounds. The takeoff weight of the airplane on the morning of the accident was calculated by the NTSB to be between 8,560 pounds and 8,882 pounds (considering the minimum and maximum fuel combinations), with a longitudinal center of gravity between 197 inches and 198 inches aft of datum. The longitudinal CG limits at these weights are between 196 and 204 inches aft of datum. These weights were derived from available weight and balance records, occupant weights provided by the FAA, coroner records, cargo/baggage information provided by the operator, and estimated fuel in each wing as described below:

Empty weight of airplane -- 4,948 pounds Pilot and Passengers -- 1,228 pounds Cargo(freight and casket) -- 516 Cargo(Bypass mail) -- 354 pounds Cargo (baggage) -- 364 pounds Zero Fuel Weight -- 7,410 pounds

Estimated fuel right wing -- 350 pounds Estimated fuel left wing -- 800 to 1,122 pounds

Total weight at takeoff -- 8,560 to 8,882 pounds

The fuel in the airplane at takeoff was derived by using the estimated fuel remaining in the wings from the previous flight, and the estimated fuel added to the left wing by the company lineman

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

immediately prior to the accident flight.

Lateral fuel loading imbalance has a limit published in the Pilot Operating Handbook of 200 pounds.

The lateral fuel imbalance (left wing heavy), is estimated to have been between a minimum of 450 pounds, to a maximum of 991 pounds.

METEOROLOGICAL INFORMATION

Morning civil twilight at Barrow on November 8 was 0924.

The reported weather at 0750 was a few clouds at 14,000 feet, 7 miles visibility, with winds from 170 degrees at eight knots. The outside air temperature was 12 degrees Fahrenheit, with a dew point of 7 degrees Fahrenheit.

The pilot of a DC-6 which landed about one hour before the accident indicated he was able to see Barrow from about 100 miles away. This pilot was preparing to depart when the accident occurred, and described light winds. He said in a written statement that he did not notice any ice or frost in the air, and that none formed on his airplane during his approximately one hour of ground time.

Heavy frost was described as having formed on vehicles and aircraft which were parked outside overnight, by the pilot of the Cessna 207 who witnessed the accident. The witness pilot told the NTSB that his airplane had accumulated a "heavy frost" and it took him approximately 15 minutes to clean it off. He said that it usually took him about five minutes to clean frost off his airplane.

The company lineman who fueled the left wing of the accident airplane said he noticed a coating on the wings and described it as a "rough glaze like you get on a car window." He demonstrated what the ice looked like to the NTSB operations group by sliding a piece of ice off an automobile window. This piece was a very thin, fragile, transparent, piece of ice. The lineman said the lower surfaces and windows were free of ice and frost. Other town residents also described frost on vehicles.

The accident pilot was already at work loading his airplane when other employees arrived. Company employees interviewed by the NTSB were not aware of the pilot removing frost or ice from the airplane. The accident pilot had been observed on other occasions applying an unknown fluid to wing surfaces with a garden sprayer. This was not noted by company employees the morning of the accident.

COMMUNICATIONS

The local FSS and traffic advisory frequency is 123.6 MHz. The unofficial common frequency used by local pilots for air to air communications is 127.77 MHz.

The pilot filed his flight plan and made common traffic advisory transmissions on 123.6 MHz. All recorded voice transmissions from the pilot on 123.6 MHz were ground transmissions. No inflight transmissions were received or recorded. The accident pilot was also communicating with the pilot of the Cessna 207 who departed before him, on 127.77 MHz. The frequency 127.77 is not recorded.

The NTSB IIC, and members of the Operations Group, listened to recorded radio transmissions between the airplane and the FSS. None of the members could discern any noises on 123.6 MHz which corresponded to any cockpit warning horns.

AERODROME INFORMATION

The Will Rogers-Wiley Post Memorial Airport is located on the coast of the Arctic Ocean, and consists of a single, paved, 6,500 feet long runway, oriented 06-24. The runway is equipped with runway end identifier lights, runway edge lights, and medium intensity approach lights located at

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

the approach end of runway 06.

The accident airplane's takeoff from runway 24 departed over the water, and made a left turn toward Wainwright. The intended route of flight paralleled the shoreline. During hours of darkness, this direction of departure is toward dark water and featureless ice.

The airport is uncontrolled, and has an FAA Flight Service Station located at the field. This facility provides weather observations and traffic advisory services to pilots.

WRECKAGE AND IMPACT INFORMATION

The NTSB on site investigation began at 2200 on November 8, 1997. The NTSB IIC, and two FAA inspectors from the Fairbanks, Alaska, Flight Standards District Office (FSDO) arrived in Barrow and began an inspection of the wreckage which had been initially recovered. Additional NTSB and FAA representatives from Washington, DC, arrived on November 9. The investigative team then formed an Operations Group comprised of members from the NTSB, FAA, and the operator; and an Airworthiness / Maintenance Group comprised of members from the NTSB, FAA, the operator, Cessna Aircraft Company, and Pratt & Whitney.

The airplane was towed to the beach, with the left wing attached, where it was not disturbed until the NTSB conducted the initial examination. The airplane was then relocated to a hangar facility at the Navy Arctic Research Laboratory in Barrow, along with the right wing and powerplant, which were recovered separately.

The four aileron balance weights, and all attaching screws, were intact, tight, and showed no evidence of binding on the flight controls. The control column was inspected with no evidence that the control lock was installed at impact. The aileron trim control indicator was found on the full right wing down trim index. No indications of flight control system anomalies were noted.

The trailing edge flaps were found in the zero (0) degrees, or retracted position. The wing spoilers were retracted. The company procedure is to rotate the airplane for takeoff at 75 knots with flaps set at 20 degrees. Flaps are then retracted to 10 degrees at 85 knots, and retracted to 0 degrees at 95 knots.

The engine and propeller assembly separated from the fuselage and was recovered. Two of the three propeller blades fractured at the blade hubs and were not located.

A witness mark on the Interstage Turbine Temperature (ITT) gauge face read 850 degrees Centigrade. The takeoff temperature limits for the PT-6A-114A engine are 805 degrees Centigrade. The 2 second transient limit for ITT is 865 degrees Centigrade.

The leading edges of both wings were crushed aft along their entire span. Both wings exhibited outward bulging at the location of the integral fuel tanks.

The right wing separated from the fuselage during the recovery efforts, and the left wing remained attached by cables. Both fuel selector handles, located on the cockpit overhead panel, were found in the off position. The two left wing tank fuel selector valves, located in the left wing root, were found in the closed position. The two right wing tank fuel selector valves, located in the right wing root, were found in a partially open position. Push-pull cables connect the valves located at the wing roots to the selector handles located in the cockpit ceiling. These cables, when stretched outboard, move the valves toward the closed position.

A functional check of the "Fuel Selector OFF" warning system revealed that the system was operable.

This system activates if both Fuel Selector Valves are placed in the "OFF" position. The cockpit indications produced are a flashing "FUEL SEL OFF" warning light, and an aural horn.

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

During the inspection of the airplane in the NARL hangar in Barrow, the motive flow fuel line inside the reservoir tank was found twisted. The complete reservoir tank assembly was removed for further testing.

No discrepancies were found with the pitot-static system, or the flight attitude indicating system.

MEDICAL AND PATHOLOGICAL INFORMATION

A postmortem examination was performed on the pilot by the State of Alaska Medical Examiner, 5700 East Tudor Road, Anchorage, Alaska, on November 10, 1997. The examination report cited "multiple impact injuries" as the cause of death.

Toxicological samples taken from the pilot were analyzed by the FAA Civil Aeromedical Institute, Oklahoma City, Oklahoma. According to the toxicology report (attached), all tests were negative.

SURVIVAL ASPECTS

All occupants located in passenger seats 2A through 4B were still restrained in their respective seats. The integral lap belt/shoulder harness passenger restraints remained intact. These belts are designed so that the shoulder harness will be in place on the passenger when the lap belt is fastened. The seat frames fractured at the weld joints, allowing the seats to rotate forward. The seat legs all remained attached to the seat rails. These seats were installed under a Supplemental Type Certificate modification. These seats did not incorporate load limiting features.

The two cockpit seats, manufactured by Cessna, remained attached to the floor structure. Both of these seats exhibited forward, and right, ductile deformation. These seats incorporate design features which allow the seats to deform in the direction of impact, thereby attenuating the energy transmitted to the seat occupant.

The 418 pound casket carried as cargo in the cabin was secured to the floor using two fore and aft oriented, one-inch wide tubular nylon cargo straps. An additional strap was oriented diagonally across the casket between the two primary tiedowns. These straps were found parted at midspan, and the casket had moved forward, impacting the back of the seats located at positions 3A and 4B.

TESTS AND RESEARCH

Fuel samples taken from the company fuel supply tank nozzle and filters were tested by the Air Force fuels laboratory located at Elmendorf Air Force Base in Anchorage (see appended test results). These tests confirmed the fuel to be Jet-A. The accident airplane was the last airplane fueled from the company fuel tank prior to the sample.

On January 5, 1998, the NTSB IIC used a Cessna 208B to determine if the Telex model ANR-4100 active noise reduction headset worn by the pilot at the time of the accident could have eliminated his ability to hear stall or fuel selector warning horns. All aural warnings were clearly audible with the engine operating and the headset active.

The caution advisory panel light bulbs were examined at the Safety Board's metallurgical laboratory for evidence of illumination at impact. The RIGHT FUEL LOW bulb filaments exhibited hot, ductile stretching.

The Pratt & Whitney PT-6A-114A engine was examined at the Pratt & Whitney Engines, Montreal, Canada facility on December 17, 1997, with all parties to the investigation represented. Details are contained in the Airworthiness Group Chairman's Factual Report. No preaccident anomalies were noted. Rotational damage was observed throughout the powerplant. Impact marks on the propeller

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

guides indicated a blade angle consistent with an applied horsepower of 497 shaft horsepower, plus or minus 50 horsepower (see Airworthiness Group Chairman's Factual Report). No indication of blade slippage in the propeller hub was noted.

The fuselage reservoir fuel tank was inspected by representatives of Cessna, the NTSB, and the FAA, at Cessna Aircraft Company on December 15, 1997. The entire assembly passed an acceptance test. The motive flow fuel pressure line, internal to the tank, was observed to be twisted. This line was installed into an operational Cessna 208B airplane, and the engine on that airplane operated within nominal acceptance parameters.

The NTSB IIC tested the reservoir fuel tank and determined that once the usable fuel in the tank was consumed, and the fuel supply line to the engine driven fuel pump was dry, there would be insufficient fuel remaining in the tank to refill the fuel line to the engine driven pump when the airplane was placed in a steep, nose down attitude.

Flight tests were conducted by Cessna Aircraft Company in August 1998, at the request of the Safety Board, to determine controllability of the Cessna 208B at various airspeed and lateral fuel imbalance combinations. A Cessna 208B was flown to a maximum 600 pound imbalance, at airspeeds between 70 and 120 knots, at flap settings of 0 degrees and 20 degrees. Control wheel deflection was measured to establish remaining control available. The maximum control wheel deflection attained was about 28 degrees. The maximum control wheel deflection available is 55 degrees. All tests were performed with an uncontaminated airfoil. No attempt was made to simulate frost during these tests.

One test included full left wing down aileron trim, combined with a left wing heavy imbalance of 600 pounds. In this condition, the airplane was controllable with flaps at 0 degrees, between 105 knots and 120 knots.

The test airplane was flown from takeoff to landing, in both a left and a right circling direction, with lateral trim neutral, and a 600 pound left wing heavy lateral imbalance. Winds were variable from 180 degrees to 220 degrees, at 13 knots gusting to 18 knots. The magnetic heading of the runway used was 193 degrees.

These tests provided control deflection versus lateral imbalance curves (attached) which, when extrapolated to an imbalance of 1,000 pounds for an airplane configured with 0 degrees of flaps, show an expected control wheel deflection of 26 degrees.

During September and October 1998, Cessna Aircraft Company performed a series of flight tests on a Cessna 208B to determine handling characteristic effects of simulated frost disruption of the main wing boundary layer. No boundary layer disruption source was applied to the horizontal stabilizer surfaces. Application of a disruptive sandpaper strip at the 25% chord line varied from 0% to 100% spans. Spans greater than 50% yielded an increase in published stalling speeds of three to five knots. These tests were not attempted at a surface coverage greater than a 3-inch wide strip. No tufting of the wing surfaces to provide a visual presentation of boundary layer separation was utilized.

The Cessna 208B wing is comprised of a NACA 23012 airfoil section. Several ice contamination effects studies (excerpts appended) have been performed on the NACA 230XX series airfoil. In the investigation of the Comair EMB-120 accident near Monroe, Michigan, on January 9, 1997, the Safety Board examined experimental and computational data for the NACA 23012 airfoil used on the EMB-120 with ice contamination (reference NTSB report DCA-97-MA-017 for a full discussion of past and recent research), including recent experimental data from the University of Illinois. Also in support of this EMB-120 accident investigation, NASA performed a full Navier-Stokes CFD calculation report for the NACA 23016 airfoil with ice accretions and aileron deflections. In 1979, the Douglas Aircraft Company (under the direction of Dr. R. E. Brumby, PhD) completed several studies

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

of the NACA 23012 airfoil used on the DC-9 hard wing. The results of these studies all showed the same trend of decreased stall angle of attack when contamination is present, and differing reductions in the stall angles of attack for contaminated airfoils with upward and downward deflected ailerons. According to these three studies, when the angle of attack on an airplane's wing increases beyond the contamination reduced stall angle of attack, and the airplane has oppositely deflected ailerons, the resulting asymmetric stall can impart a rolling moment to the airplane. This tendency can be aggravated during increasing angle of attack situations (such as raising of trailing edge flaps).

In researching the potential effects of frost contamination on the upper surface of wings, Douglas Aircraft Company (under the direction of Dr. R. E. Brumby, PhD), stated in "The Effect of Wing Ice Contamination on Essential Flight Characteristics" (appended):

1. "...for an airplane with ice contamination, not only does stall onset occur at a lower than normal angle of attack, the airplane angle of attack must be increased in order to produce the required lift at normally scheduled speeds. ... The increasingly unsteady airflow over the wing results in correspondingly degraded lateral stability, requiring larger and larger control wheel inputs to keep the aircraft from rolling off. ... the airplane becomes increasingly unstable, eventually stalling without stick shaker activation at speeds normally scheduled for takeoff."

2. "...it becomes readily apparent that it takes only a relatively small amount of roughness on the wing upper surface to cause large increases in stall speeds even with slats extended."

3. Figure 7 (appended) depicts the percent increase in stall speed versus roughness element height/wing chord (K/C). The simulated frost range adhering to the entire upper surface shows an increase in stall speed between 20% and 40%.

FAA Advisory Circular (AC) 20-117, "Hazards Following Ground Deicing and Ground Operations in Conditions Conducive to Aircraft Icing" states "Wind tunnel and flight tests indicate that ice, frost, or snow formations on the leading edge and upper surface of a wing, having a thickness and surface roughness similar to medium or coarse sandpaper, can reduce wing lift by as much as 30 percent and increase drag by as much as 40 percent." It goes on to say that "Ice, frost, or snow formed on these surfaces on the ground can have a totally different effect on aircraft flight characteristics than ice formed in flight."

Appendix 3 of AC 20-117 lists numerous effects of ice formations on flight characteristics. Among these are "(2)(ii) Surface roughness on the afterbody of a wing can have an effect approximately equal to the effect of similar surface roughness on the leading edges of some airfoils. ... (v) Stall angle of attack will decrease and in some aircraft stall will occur prior to activation of stall warning devices. ... (vii) Controllability may be reduced requiring more stick deflection for maneuvers or stall recovery."

AC 120-58, "Pilot Guide - Large Aircraft Ground Deicing / Preface / Clean Aircraft Concept" states: "Thicker or rougher frozen contaminants can have increasing effects on lift, drag, stall speed, stability and control, with primary influence being surface roughness located on critical portions of an aerodynamic surface. These adverse effects on the aerodynamic properties of the airfoil may result in sudden departure from the commanded flight path and not be preceded by any indications or aerodynamic warning to the pilot. Therefore it is imperative that takeoff not be attempted unless the PIC has ascertained, as required by regulation, that all critical surfaces of the aircraft are free of adhering ice, snow, or frost formations."

The FAA publication, TIPS ON WINTER FLYING - FAA-8740-24 / OPERATION OF AIRCRAFT, says: "Removal of Ice, Snow, and Frost - A common winter accident is trying to take off with frost on the wing surface. It is recommended that all frost, snow, and ice be removed before attempting flight."

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

14 CFR Part 91.577 states, in part, that "(a) No pilot may takeoff an airplane that has- ...(2) Snow or ice adhering to the wings or stabilizing or control surfaces; or (3) Any frost adhering to the wings or stabilizing or control surfaces, unless that frost has been polished to make it smooth."

ADDITIONAL INFORMATION**Company Information**

Hageland Aviation Services, Inc., began operation in 1985, and had about 115 employees, including 34 pilots, at the time of the accident. They were authorized to conduct scheduled and on demand operations with nine or less passengers. The company operated from eight communities in Alaska, and based airplanes in three communities. The aircraft fleet of 29 airplanes included four Cessna 208Bs, 20 Cessna single-engine piston airplanes, four Cessna 402C twin-engine airplanes, and one Beech E-18 twin-engine airplane. The majority of airplanes were owned by Hageland Aviation Services, Inc., or leased from Gussic Ventures, Inc., or individuals. Gussic Ventures, Inc., is a partnership of three principals from Hageland Aviation Services, Inc.

Since 1996, the company had four accidents, two involving fatalities. After the company had a fatal accident involving a Cessna 208B on April 10, 1997, the company created a position of safety officer. At the time of the accident, this position was filled by a contractor, not a company employee, who did not reside in Alaska.

Ground Icing Procedures

14 CFR 135.227(a) allows pilots of aircraft to takeoff "...with "frost adhering to the wings, or stabilizing or control surfaces, if the frost has been polished to make it smooth."

14 CFR 135.227 (b) says in part, "No certificate holder may authorize an airplane to takeoff and no pilot may takeoff... any time conditions are such that frost ... may reasonably be expected to adhere to the airplane unless ... one of the following requirements is met: (1) A pretakeoff contamination check, that has been established by the certificate holder and approved by the Administrator for the specific airplane type, has been completed within 5 minutes prior to beginning takeoff. A pretakeoff contamination check is a check to make sure that the wings and control surfaces are free of frost, ice, or snow. (2) The certificate holder has an approved alternative procedure and under that procedure the airplane is determined to be free of frost, ice, or snow."

The company was authorized in the FAA approved Operations Specifications to operate airplanes under ground icing conditions, if conducted as outlined in the Hageland General Operations Manual. This manual stated in the "Pretakeoff Contamination Check" that "Any snow or ice adhering to any of the surfaces will have to be removed before a takeoff is attempted." The section titled Cold Weather and Ground Icing Operations stated that "No aircraft shall takeoff with frost, snow or ice adhering to its propeller, windshield, powerplant, and pitot-static system. No aircraft shall takeoff with snow, ice or frost adhering to the wings, stabilizers or control surfaces unless the frost has been polished smooth. ...all control surfaces, wings, stabilizers, windshields, propellers and pitot-static systems will be completely free of any frost, snow or ice before any takeoff is attempted."

At the time of the accident, Hageland did not have, nor were they required to have, an FAA approved deicing program.

During the investigation, the President of Hageland Aviation stated to the NTSB Operations Group Chairman that the company procedures are defined in the Operations Specifications; essentially, if

National Transportation Safety Board

FACTUAL REPORT**AVIATION**

NTSB ID: ANC98MA008

Occurrence Date: 11/08/1997

Occurrence Type: Accident

Narrative (Continued)

there is any level of ice, it should be removed.

The Cessna 208B pilot operating Handbook, Section 4, Normal Procedures, has four "!WARNINGS" concerning removal of frost before flight. On page 4-4, 4-6, and 4-7, under "preflight," is the statement "!WARNING It is essential in cold weather to remove even small accumulations of frost, ice, or snow... ."

FAA oversight

The company area of operations extends over two FSDO's geographic areas of responsibility. The Certificate Holding District Office (CHDO) is located in Anchorage, Alaska. The FSDO responsible for providing geographic support for oversight of company line station operations in Barrow is located in Fairbanks, Alaska.

The Principal Operations, Maintenance, and Avionics Inspectors (POI, PMI, PAI) assigned to manage the Hageland Aviation Services, Inc., certificate were assigned to the Anchorage FSDO.

During Fiscal Year 1997 (October 1, 1996 to September 30, 1997), 22 required ("R" item) inspections were completed by the Anchorage FSDO, and 60 additional planned ("P" item) inspections were completed. This is an increase from FY-96, when 22 "R" item and 29 "P" item inspections were performed. During FY-96, the Fairbanks FSDO completed 1 inspection, and in FY-97, 14 inspections.


In none of the previous three years did any of the Principal Inspectors from Anchorage visit Hageland's Barrow station. The first record of the Fairbanks FSDO having visited the Hageland station in Barrow was the last week of October 1997, one week prior to the accident.


Three weeks after this accident, the FAA conducted a Regional Aviation Safety Inspection Program (RASIP) inspection (report attached) of Hageland Aviation Services, Inc. According to this report, the FAA found "the lines of authority were not well defined, and those that are defined sometimes are not followed." The report also found that "Use of checklists by pilots was done on an occasional basis. Pilot habit patterns indicated that these airmen were not using checklists and were very uncomfortable with the need to do so because the FAA was onboard the aircraft. ... Some pilots were unable to determine the seat configuration of the airplane and the resultant empty weight and C.G. Many took an exceptional amount of time to do a weight and balance."


The RASIP report also stated, "1.07.07: Most company pilots do not follow the approved procedure in the company operations manual described on pages 3-5 and 3-5a, which says that the pilot-in-command shall compute the aircraft empty weight, considering the seat configuration, needed fuel load, pilot's weight, and then the pilot will confirm the available payload weight. These calculations are worked in reverse order. The cargo is loaded first, then fuel. The pilot's don't know the aircraft empty weight until after the airplane is loaded. Some pilots can not read the seat configuration data sheet and describe which configuration the aircraft is in. Cargo handlers were observed putting cargo on the aircraft without the pilot's knowledge. Some pilots have calculated wrong weight and balances, and if they wouldn't have been challenged by the FAA inspector, they would have departed with the aircraft out of the center of gravity limitations."


Release of Aircraft Wreckage:

All wreckage except the engine, center fuel tank, instruments retained for laboratory inspection, and pilot records, was released to representatives of Hageland Aviation Services, Inc., on November 12, 1997. The remaining components were released to representatives of the company, or Professional Adjusters of Alaska, Inc., Anchorage, Alaska, between November 12, 1998, and October 19, 1998.

 National Transportation Safety Board FACTUAL REPORT AVIATION		NTSB ID: ANC98MA008				
		Occurrence Date: 11/08/1997				
		Occurrence Type: Accident				
Landing Facility/Approach Information						
Airport Name WILEY POST MEMORIAL		Airport ID: BRW	Airport Elevation 10 Ft. MSL	Runway Used 24	Runway Length 6500	Runway Width 150
Runway Surface Type: Asphalt						
Runway Surface Condition: Water--choppy						
Type Instrument Approach: NONE						
VFR Approach/Landing: None						
Aircraft Information						
Aircraft Manufacturer Cessna		Model/Series 208B		Serial Number 208B-0504		
Airworthiness Certificate(s): Normal						
Landing Gear Type: Tricycle						
Homebuilt Aircraft? No		Number of Seats: 7	Certified Max Gross Wt. 8750 LBS	Number of Engines: 1		
Engine Type: Turbo Prop		Engine Manufacturer: P&W	Model/Series: PT6A-114	Rated Power: 675 HP		
- Aircraft Inspection Information						
Type of Last Inspection Continuous Airworthiness		Date of Last Inspection 11/01/1997	Time Since Last Inspection 28 Hours	Airframe Total Time 1466 Hours		
- Emergency Locator Transmitter (ELT) Information						
ELT Installed? Yes		ELT Operated? Yes	ELT Aided in Locating Accident Site? No			
Owner/Operator Information						
Registered Aircraft Owner GUSSIC VENTURES, INC.		Street Address 7325 FOXRIDGE CIRCLE, SUITE 1				
		City ANCHORAGE	State AK	Zip Code 99518		
Operator of Aircraft HAGELAND AVIATION SERVICES INC		Street Address HANGAR, PO BOX 195				
		City ST. MARY'S	State AK	Zip Code 99658		
Operator Does Business As:			Operator Designator Code: EPUA			
- Type of U.S. Certificate(s) Held:						
Air Carrier Operating Certificate(s): Commuter Air Carrier; On-demand Air Taxi						
Operating Certificate:			Operator Certificate:			
Regulation Flight Conducted Under: Part 135: Air Taxi & Commuter						
Type of Flight Operation Conducted: Unknown						
FACTUAL REPORT - AVIATION						

 National Transportation Safety Board FACTUAL REPORT AVIATION		NTSB ID: ANC98MA008																																																																																
		Occurrence Date: 11/08/1997																																																																																
		Occurrence Type: Accident																																																																																
First Pilot Information																																																																																		
Name		City		State	Date of Birth	Age																																																																												
On File		On File		On File	On File	40																																																																												
Sex: M	Seat Occupied: Left	Principal Profession: Civilian Pilot			Certificate Number: On File																																																																													
Certificate(s): Airline Transport; Commercial; Foreign																																																																																		
Airplane Rating(s): Multi-engine Land; Single-engine Land																																																																																		
Rotorcraft/Glider/LTA: None																																																																																		
Instrument Rating(s): Airplane																																																																																		
Instructor Rating(s): None																																																																																		
Type Rating/Endorsement for Accident/Incident Aircraft? Yes				Current Biennial Flight Review?																																																																														
Medical Cert.: Class 1		Medical Cert. Status: Valid Medical--no waivers/lim.			Date of Last Medical Exam: 02/20/1997																																																																													
<table border="1"> <tr> <th>- Flight Time Matrix</th> <th>All A/C</th> <th>This Make and Model</th> <th>Airplane Single Engine</th> <th>Airplane Multi-Engine</th> <th>Night</th> <th colspan="2">Instrument Actual Simulated</th> <th>Rotorcraft</th> <th>Glider</th> <th>Lighter Than Air</th> </tr> <tr> <td>Total Time</td> <td>3500</td> <td>200</td> <td>3470</td> <td>30</td> <td>100</td> <td>50</td> <td>50</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Pilot In Command(PIC)</td> <td>3400</td> <td>200</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Instructor</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Last 90 Days</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Last 30 Days</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>Last 24 Hours</td> <td>16</td> <td>16</td> <td>16</td> <td></td> <td>1</td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </table>						- Flight Time Matrix	All A/C	This Make and Model	Airplane Single Engine	Airplane Multi-Engine	Night	Instrument Actual Simulated		Rotorcraft	Glider	Lighter Than Air	Total Time	3500	200	3470	30	100	50	50				Pilot In Command(PIC)	3400	200									Instructor											Last 90 Days											Last 30 Days											Last 24 Hours	16	16	16		1					
- Flight Time Matrix	All A/C	This Make and Model	Airplane Single Engine	Airplane Multi-Engine	Night	Instrument Actual Simulated		Rotorcraft	Glider	Lighter Than Air																																																																								
Total Time	3500	200	3470	30	100	50	50																																																																											
Pilot In Command(PIC)	3400	200																																																																																
Instructor																																																																																		
Last 90 Days																																																																																		
Last 30 Days																																																																																		
Last 24 Hours	16	16	16		1																																																																													
Seatbelt Used? Yes		Shoulder Harness Used? Yes			Toxicology Performed? Yes		Second Pilot? No																																																																											
Flight Plan/Itinerary																																																																																		
Type of Flight Plan Filed: VFR																																																																																		
Departure Point		State	Airport Identifier	Departure Time	Time Zone																																																																													
Same as Accident/Incident Location			BRW	0806	AST																																																																													
Destination		State	Airport Identifier																																																																															
WAINWRIGHT		AK	AIN																																																																															
Type of Clearance: VFR																																																																																		
Type of Airspace: Class G																																																																																		
Weather Information																																																																																		
Source of Briefing: No record of briefing																																																																																		
Method of Briefing:																																																																																		

 National Transportation Safety Board FACTUAL REPORT AVIATION		NTSB ID: ANC98MA008			
		Occurrence Date: 11/08/1997			
		Occurrence Type: Accident			
Weather Information					
WOF ID	Observation Time	Time Zone	WOF Elevation	WOF Distance From Accident Site	Direction From Accident Site
BRW	0806	AST	10 Ft. MSL	1 NM	90 Deg. Mag.
Sky/Lowest Cloud Condition: Scattered			14000 Ft. AGL		Condition of Light: Night/Dark
Lowest Ceiling: None			0 Ft. AGL		Visibility: 7 SM Altimeter: 29.00 "Hg
Temperature: 12 °C		Dew Point: 7 °C		Wind Direction: 170 Density Altitude: Ft.	
Wind Speed: 8		Gusts:		Weather Conditions at Accident Site: Visual Conditions	
Visibility (RVR): 0 Ft.		Visibility (RVV) 0 SM		Intensity of Precipitation: Unknown	
Restrictions to Visibility: None					
Type of Precipitation: None					
Accident Information					
Aircraft Damage:		Aircraft Fire:		Aircraft Explosion	
Classification:					
- Injury Summary Matrix	Fatal	Serious	Minor	None	TOTAL
First Pilot	1				1
Second Pilot					
Student Pilot					
Flight Instructor					
Check Pilot					
Flight Engineer					
Cabin Attendants					
Other Crew					
Passengers	7				7
- TOTAL ABOARD -	8				8
Other Ground	0	0	0		0
- GRAND TOTAL -	8	0	0		8

 <p>National Transportation Safety Board</p> <p>FACTUAL REPORT</p> <p>AVIATION</p>	NTSB ID: ANC98MA008	
	Occurrence Date: 11/08/1997	
	Occurrence Type: Accident	
Administrative Information		
<p>Investigator-In-Charge (IIC)</p> <p>MATTHEW L. THOMAS</p>		
<p>Additional Persons Participating in This Accident/Incident Investigation:</p> <p>VICTORIA ANDERSON(FAA-AAI-100) 800 INDEPENDENCE AVE., SW WASHINGTON, DC 20591</p> <p>PAUL R MISENCIK NTSB(AS-30);490 L'ENFANT PLAZA WASHINGTON, DC 20594</p> <p>THOMAS A BERTHE P&W; 15 EAGLE DRIVE S. BURLINGTON, VT 05403</p> <p>JEROME FRESCHETTE NTSB(AS-40);490 L'ENFANT PLAZA WASHINGTON, DC 20594</p>		
<p>FACTUAL REPORT - AVIATION</p> <p>Page 5</p>		